

PO Box 881, Morwell, Victoria 3840, Australia Ph + 61 (0) 3 5172 1200 Fax + 61 (0) 3 5172 1201 www.gippsaero.com

SB-GA8-2001-01

Issue 1

MANDATORY

Service Bulletin

Subject:

Replacement of tailplane mount rivets with bolts.

Applicability:

GA8 all serial numbers up to and including GA8-01-007.

Background:

Service experience has shown the rivets which attach the rear tailplane attach brackets to the fuselage may work and fail.

Instructions:

- 1. For aircraft with less than 200 hours total time in service the rivets attaching the rear tailplane attach bracket to the fuselage must be inspected, both inside and outside, before next flight. As part of this inspection the tailplane should be pushed at the tip in a for and aft direction while a second person inspects the fittings for relative movements.
 - If any sign of working rivets are found action 2 must be completed before next flight. If no sign of working rivets is found action 2 must be completed at the next 100 hourly inspection.
- 2. Aircraft with more than 200 hours time in service and those required to comply with this action under action 1 must be modified by removing the top four rivets, drilling the holes out to 3/16" Ø and installing four AN3-6A bolts with AN960-10 series washers and either MS21042-1032 or AN365-1032 nuts. Ensure the correct thread engagement is achieved by the use of AN960-10 and AN960-10L washers as necessary.

This Service Bulletin is approved pursuant to CAR 35 of the Civil Aviation Regulations (1988)

SB-GA8-2001-01 | Issue: 1 | Date of Issue: 27 September 2001 | Page 1 of 2

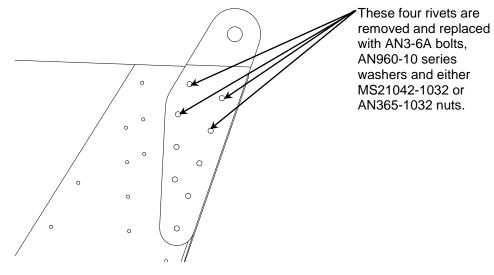


Figure 1

3. Following modification in accordance with action 2 the attachment of the fitting to the fuselage must be inspected at every 100 hourly inspection for any signs of looseness, relaxing of the bolts, further working rivets or general damage. Any defects must be reported to Gippsland Aeronautics before further operation.

Weight and Balance:

Negligible effect.

Documentation:

Update aircraft log book to reflect incorporation of this Service Bulletin.

Compliance Notice:

Complete the Document Compliance Notice and return to Gippsland Aeronautics by mail, fax or email.

DOCUMENT COMPLIANCE NOTICE



Document: Service Bulletin SB-GA8-2001-01

Issue 1

Aircraft Serial Number:	GA8		
Service Bulletin SB-GA8-2001-01	Issue 1	has been incorporated in the	ne above aircraft.
Date:			-
Signed			
On behalf of (company name):			
Please post fax or email this comp	oliance no	otice to:	

Gippsland Aeronautics Attn: Technical Services P.O. Box 881 Morwell Victoria 3840

Australia

Fax.: +61 03 5172 1201 Email: techrec@gippsaero.com