

SB-GA8-2005-25

Issue 1

**MANDATORY** 

PO Box 881, Morwell, Victoria 3840, Australia Ph + 61 (0) 3 5172 1200 Fax + 61 (0) 3 5172 1201 www.gippsaero.com

# **Service Bulletin**

Subject:		

Remarking of	airspeed	indicator	white	and	green	arcs.

## Applicability:

All GA8 aircraft up to serial number GA8-05-075.

(Aircraft S/N's GA8-05-075 and subsequent have been fitted with remarked airspeed indicators during production and are not subject to the requirements of this Service Bulletin).

#### **Amendments:**

Nil - Initial Issue.

### **Background:**

Additional flight testing of the GA8 to validate the calibration of the pitot-static system in slow speed flight near the stall has resulted in amended figures for indicated stall speeds. Accordingly the lower limits of the white and green arcs on the airspeed indicator (ASI) are required to be remarked. Note that the change of markings to the ASI has no affect on the stated indicated and calibrated airspeeds quoted in the Approved Flight Manual.

#### Compliance:

MANDATORY - to be completed at or before the next scheduled periodic inspection.

#### Weight and Balance:

Negligible effect on weight and balance.

#### Approval:

This Service Bulletin has been approved pursuant to Regulation 21.095 of CASR1998.

#### Parts:

Item	P/N	Description	Qty
1	GA8-341012-15 <sup>1</sup>	Airspeed Indicator	1

<sup>&</sup>lt;sup>1</sup> Existing ASI may be reworked – refer to text for details

# **Parts Availability:**

New parts can be obtained directly from Gippsland Aeronautics.

Tel.: +61 03 5172 1200 Fax.: +61 03 5172 1201

Email: spares@gippsaero.com

#### **Instructions:**

### **Airspeed Indicator Replacement**

1. Remark the existing ASI (P/N GA8-341012-11) white arc to commence at 57 knots, and the green arc to commence at 64 knots. Refer to Figure 1. Re-identify the modified part as GA8-341012-15.

Alternatively, remove existing ASI and replace with new ASI (P/N GA8-341012-15).

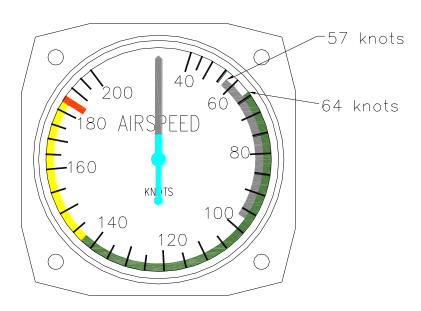


Figure 1 -Airspeed indicator marking

SB-GA8-2005-25	Issue: 1	Date of Issue: 15 July 2005	Page 2 of 3
----------------	----------	-----------------------------	-------------

2. After reinstalling ASI conduct leak test of pitot-static system per Section 34-10-00 of the GA8 Service Manual.

#### **Documentation:**

- 1. Incorporate Flight Manual Amendment dated 31 May 2005 into the Approved Flight Manual (AFM).
- 2. Hand amend the airspeed indicator dash number on page 6-18 of Section 6 of the AFM from -11 to 15.
- 3. Update aircraft log book to reflect incorporation of this Service Bulletin.

# **Compliance Notice:**

Complete the Document Compliance Notice and return to Gippsland Aeronautics by fax/mail.

# **DOCUMENT COMPLIANCE NOTICE**



Attn: Technical Services

Morwell Victoria 3840

Fax.: +61 03 5172 1201

P.O. Box 881

Australia

**Document: Service Bulletin SB-GA8-2005-25** 

Aircraft Serial Number:	GA8	
I/we have incorporated Serv	rice Bulletin SB-GA8-2	2005-25 for the above aircraft.
Signed		_
Print Name		_
Please post or fax this comp	oliance notice to:	
Gippsland Aeronauti	cs	