

## Service Bulletin

---

**Subject:**

Passenger Seat Harness Slider Cover

**Applicability:**

GA8 Serial Numbers GA8-00-004 to GA8-08-132 or any seat shipped before Thursday, 26 June 2008.

**Amendments:**

Issue 2: Applicability and supplier details revised. Warranty section removed.

**Background:**

In response to reports from operators of loss of the metal clip from the harness slider assembly, a new AmSafe cover has been introduced. This Service Bulletin details the installation of the new cover onto existing harness used on GA8 passenger seats.

**Compliance:**

For all applicable passenger seats, this Service Bulletin is to be incorporated at the next 100 hour/annual inspection after 1 March 2008.

**Weight and Balance:**

Negligible effect.

**Approval:**

The technical aspects of this Service Bulletin have been approved under a CASA Authorisation.

**Parts:**

Item	P/N	Description	Qty
1	509016-8	AmSafe Cover	6

**Parts Availability:**

Parts can be obtained directly from AmSafe.


**Labour:**

Approximately 0.5 hours should be allocated for completing the work detailed in this service bulletin.

## Instructions:

### 1. For each seat that the new cover is to be fitted:


- 1.1. Ensure the metal clip, labelled with part number AFG0667430, and the plastic C-clip, part number 505087-401, are installed correctly in the Slider Assembly. See Figure 1.
- 1.2. Install the cover over the harness clip by aligning and applying firm pressure to snap the cover in place. See Figure 2 and Figure 3.

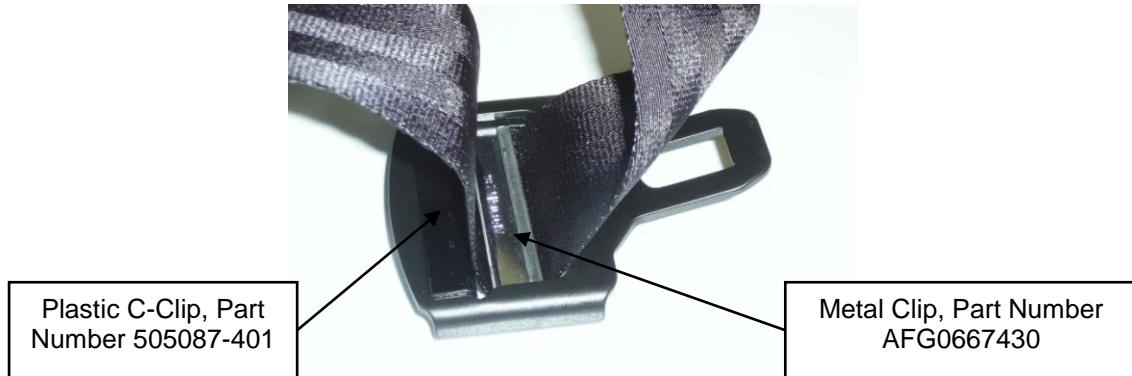

**Figure 1: Correct assembly of the Slider Assembly Part Number 504802-403-142**



**Figure 2: Harness without cover fitted**

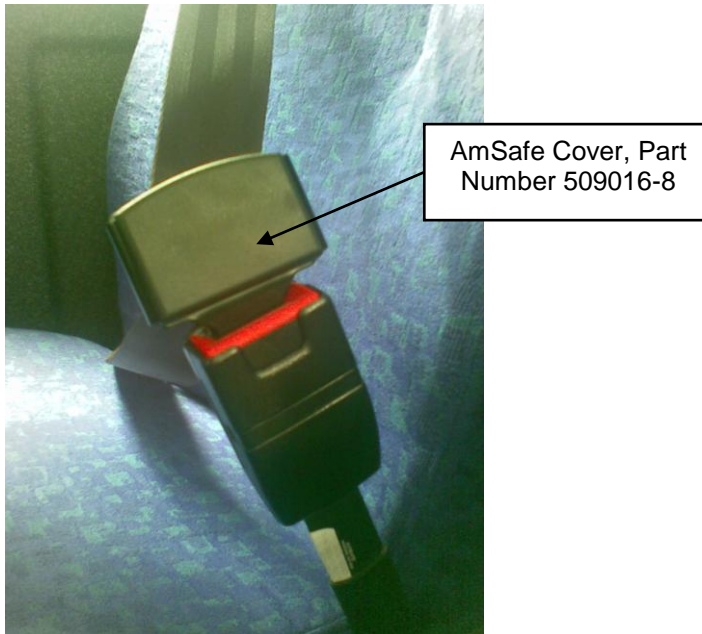

**Figure 3: Harness with cover fitted**

**Documentation:**

Update aircraft log book to reflect incorporation of this Service Bulletin.

**Compliance Notice:**

Complete the Document Compliance Notice and return to Gippsland Aeronautics by mail, fax or email.

## DOCUMENT COMPLIANCE NOTICE



Document: Service Bulletin SB-GA8-2008-43,  
Issue 2

Aircraft Serial Number: GA8-\_\_\_\_\_

Service Bulletin SB-GA8-2008-43 Issue 2 has been incorporated in the above aircraft.

Date: \_\_\_\_\_

\_\_\_\_\_  
Signed

Print Name: \_\_\_\_\_

Please post or fax this compliance notice to:

Gippsland Aeronautics  
Attn: Technical Services  
P.O. Box 881  
Morwell Victoria 3840  
Australia  
Fax.: +61 03 5172 1201